

Manhole Inspection Summary

Manhole # S03AA2003MH

Printed On: 12/17/2008

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **03AA2** Node: **003** Status: **Found**

Insp Date: **8/9/06 9:03 AM**

Incomplete Comments

Crew: **WM, BH**
Inspector: **Morris, W**
Firm: **RKK**

Location Address: **6100 CROSS COUNTRY BLVD**

Cross Street: **TANEY RD**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **2** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **8** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

Bench

☒ Exists Material: **Brick**

☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

☒ **Debris** (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **5** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S03AA2003MH


Printed On: 12/17/2008

Page 2 of 5

Location View



Top View

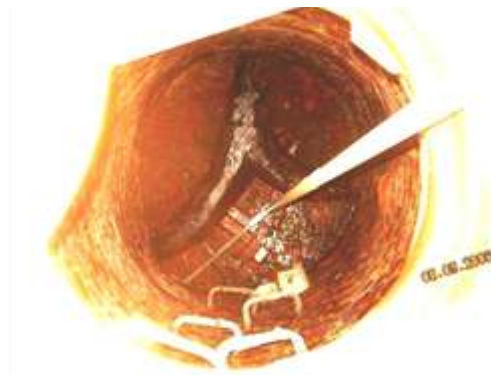

Adjustment loose brick and infiltration.
Barrel infiltration. Corroded steps. Bench
debris.

Manhole Inspection Summary

Manhole # S03AA2003MH

Printed On: 12/17/2008

Page 3 of 5

6 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **9.12** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **2** (in.) Deposits Extent: **Heavy**

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer Pipe In @ 3 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **5.85** (ft.) Flow Characteristics: **None**

Deposits: ☒ **None** ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Unknown**

Drop In @ 3 O'Clock



Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **7.82** (ft.)

Inv Depth: **8.82** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S03AA2003MH

Printed On: 12/17/2008

Page 4 of 5

6 in. Circular Gravity Sewer

Pipe In @ 6 O'Clock



Rod and Bar (Angled)

Pipe Material: **PVC**

☐ Pipe Lined

Invert Depth: **8.00** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer

Pipe In @ 7 O'Clock



Rod and Bar (Angled)

Pipe Material: **PVC**

☐ Pipe Lined

Invert Depth: **7.93** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence**

Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S03AA2003MH

Printed On: 12/17/2008

Page 5 of 5

6 in. Circular Gravity Sewer

Pipe In @ 8 O'Clock



Barrel infiltration.

Rod and Bar (Angled)

Pipe Material: **Clay**

☐ Pipe Lined

Invert Depth: **8.95** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.)

Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Broken**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection